# 12 Carn Dearg Road Claggan Fort William PH33 6QB



Inspected on: 9th November 2022

#### Prepared by:

Samuel & Partners First Surveyors Scotland First Floor, 20 High Street FORT WILLIAM PH33 6AT

- 1. Property Questionnaire
- 2. Single Survey
- 3. Mortgage Valuation
- 4. Energy Report

# Property Questionnaire

PROPERTY ADDRESS:	12 Carn Dearg Road Claggan Fort William PH33 6QB
SELLER(S):	Mr Mohammad Hussain T/A Hussain Partnership
COMPLETION DATE OF PROPERTY QUESTIONNAIRE:	08.11.22

#### PROPERTY QUESTIONNAIRE

Information to be given to prospective buyer(s)

1.	Length of ownership					
	How long have you owned the property? Just over a year					
2.	Council Tax					
	Which Council Tax band is your property in?  A B C✓ D E F G H					
	<del>_</del>					
3.	Parking					
	What are the arrangements for parking at your property?					
	(Please indicate all that apply)					
	Garage					
	Allocated parking space					
	• Driveway					
	Shared parking					
	On street ✓					
	Resident permit					
	Metered parking					
	Other (please specify):					
4.	Conservation Area					
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?					
5.	Listed Buildings					
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?					
6.	Alterations / additions / extensions					
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?					
	If you have answered yes, please describe the changes which you have made:					
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?					

		1
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	(iii) Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed):	
	Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).	
	If you have answered yes/partial – what kind of central heating is there? Only coal fire heating and hot water.	
	(Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)	
	If you have answered yes, please answer the 3 questions below:	
b.	When was your central heating system or partial central heating system installed?	N/A
C.	Do you have a maintenance contract for the central heating system?	No
	If you have answered yes, please give details of the company with which you have a maintenance agreement:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	N/A
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Don't know
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?  If you have answered yes, is the damage the subject of any	No

b.	Are you aware of the existence of asbestos in your property?			No
	If you have answered yes, please give details:			
10.	Services			
a.	Please tick which services are connected to your property and give			
ı	details of the supplier:			
ŀ	Services Gas / liquid petroleum	Connected	Supplier	
	gas			
	Water mains / private water supply	✓		
	Electricity	✓	Pay as you Go	
	Mains drainage	✓		
	Telephone			
	Cable TV / satellite	✓		
	Broadband			
b.	Is there a septic tank sys	tem at vour prope	ertv?	No
	If you have answered yes, please answer the two questions below:			
C.	Do you have appropriate consents for the discharge from your septic tank?			
d.	Do you have a maintenance contract for your septic tank?			
	If you have answered yes, please give details of the company with which you have a maintenance contract:			
11.	Responsibilities for Shared or Common Areas			
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?  If you have answered yes, please give details:			
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?			
	If you have answered ye	<u>s,</u> please give de	tails:	
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?			

d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	
	If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:	
b.	Is there a common buildings insurance policy?	
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.  Only council tax	None
13.	Specialist Works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	N/A
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	N/A
	If you have answered yes, please give details	

C.	If you have answered yes to 13(a) or (b), do you have any quarantees relating to this work?					
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.					
	Guarantees are held by:					
14.	Guarantees					
a.	Are there any guarantees or v	varrant				
(i)	Electrical work	No	Don't Know	With title de	eeds	Lost
(ii)	Roofing	No	Don't Know	With title de	eds	Lost
(iii)	Central heating	No	Don't know	With title deeds Lo		Lost
(iv)	NHBC	No	Don't know	With title deeds Lost		Lost
(v)	Damp course	No	Don't know	With title deeds Lost		Lost
(vi)				Lost		
b.	or installations to which the guarantee(s) relate(s):					
C.	Are there any outstanding claims under any of the guarantees No listed above?					
	If you have answered yes, please give details:					
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years?				No	
	If you have answered yes, please give details:					
16.	Notices that affect your prope	erty				
	In the past 3 years have you ever received a notice:					
a.	advising that the owner of a neighbouring property has made a No.			o/Don't know		
b.	that affects your property in s	ome of	ther way?			/Don't
	know					
C.	that requires you to do any maintenance, repairs or improvements to your property?					o/Don't know

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :	
M Hussain	 
Date:08.11.22	

### survey report on:

Property address	12 Carn Dearg Road Claggan Fort William PH33 6QB
Customer	Mohammet Hussain
Guatomer	IVIONALIIIIEL I IUSSAIII
Customer address	c/o Cruachan Hotel
	Achintore Road Fort William
	PH33 6JF
Prepared by	John Strachan MRICS Samuel & Partners - FS Scotland
Date of Inspection	9 <sup>th</sup> November 2022

#### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.


Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc were not inspected or reported on.

Description	A first floor end terraced flat. The block is 3 storeys in height.
Accommodation	Entrance hall, living room, kitchen, 3 bedrooms and bathroom
Gross internal floor area (m²)	83 sq m
Neighbourhood and location	The property is set in an established social housing area close to the centre of Fort William. All essential services, amenities and transport links are nearby.
Age	1957
Weather	Overcast with light outbreaks of rain. The preceding weather was generally wet.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate  Communal rendered masonry chimney stack with concrete cope and clay pots.  There are lead flashings with the intersection with the main roof.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate
Rooming including roof space	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3 m ladder externally
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3 m ladder within the property
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so  The roof over the block is pitched and clad in a natural slate. The ridge is in a clay tile. There is a skylight to the rear.
	We did not access the roof space.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate Cast iron gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate
Wall Walls	Foundations and concealed parts were not exposed or inspected  The external walls are of cavity brickwork construction (2 walls with a narrow gap between). The walls are finished in a dry dash render.
	Internal surfaces are in a plaster on the hard or plasterboard lining.
Windows, external doors and	Internal and external doors were opened and closed where keys were available
joinery	Random windows were opened and closed where possible
, , ,	Doors and windows were not forced open Windows are in timber frame and casement with sealed double glazed panels. The flat entrance door is in timber.
External decorations	Visually inspected Windows and the external doors are stained. Rainwater goods have a paint finish.
Conservatories/porches	Visually inspected None

Communal areas	Circulation areas visually inspected  Access to the flat is through a common stairwell. The walls are in plastered masonry construction. Front and rear entrance doors are in timber. The ground floor, stairs and landings are in concrete. Stairs have a metal banister.		
	There is a shared drying green to the rear.		
Garages and permanent outbuildings	Visually inspected None. There is a coal store adjacent to the flat entrance door.		
Outside areas and boundaries	Visually inspected There is a communal drying area to the rear. We assume the garden areas to the front are owned by the ground floor properties.		
Ceilings	Visually inspected from floor level Plasterboard lined throughout.		
Internal walls	Visually inspected from floor level		
emai maile	Using a moisture meter, walls were randomly tested for dampness where considered appropriate Plastered masonry.		
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted		
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point		
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1 m between the underside of floor joists and the solum as determined from the access hatch Floors appear to be in suspended timber. The kitchen floor may be in suspended concrete. Floors were fully covered and carpeted at the time of inspection. There is no sub floor space. There is a flat below the subject property.		
Internal joinery and kitchen	Built in cupboards were looked into but no stored items were moved		
fittings	Kitchen units were visually inspected excluding appliances Facings and skirtings are in timber. Internal doors are in flush panel.		
	Kitchen fittings comprise of a melamine or plastic faced range of proprietary base and wall units with a plastic coated door, proprietary worktop, inset steel sink and integral hob and oven housing.		
Chimney breasts and	Visually inspected		
fireplaces	No testing of the flues or fittings were carried out Plastered chimney breast. There is an open fireplace to the living room with a brick surround and tiled hearth. There is a back boiler to the recess.		
Internal decorations	Visually inspected Ceilings and walls are in an emulsion paint on a plain plaster or embossed paper backing. The kitchen ceiling has an artex finish. Internal joinery is mainly painted or stained.		
Cellars	Visually inspected where there was a safe and purpose built access  None		
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on Mains electricity supply. The meter and fuse board are located at high level within the entrance hall. Electrical fittings are a mix of age.		
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on None		

Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation  No tests whatsoever were carried out to the system or appliances  Mains water supply. Plumbing supplies where viewed are in copper, wastes are in
	plastic and cast iron.
	Bathroom fittings comprise of a ceramic wc, ceramic wash hand basin and an acrylic bath. There is an electric shower over the bath. Surfaces around the bath are in a proprietary wet wall.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected
	No tests whatsoever were carried out to the system or appliances  Central heating is provided by the solid fuel back boiler to the open fireplace which heats steel radiators throughout the property. The fire was not lit at the time of inspection.
	Hot water is heated and stored in a copper cylinder located within a cupboard to the kitchen. The water can be heated by the back boiler or alternatively by a single electric immerser.
Drainage	Drainage covers etc were not lifted
Dramage	Neither drains nor drainage systems were tested Drainage connects to the mains system.
Fire, smoke and burglar	Visually inspected
alarms	No tests whatsoever were carried out to the system or appliances There are no fire or burglar alarms. There are smoke detectors in places.
	Fire Safety Legislation effective from February 2022 requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat detection alarm must be installed in every kitchen area and all smoke and heat alarms must be ceiling mounted and interlinked. Where there is a carbon fuelled appliance e.g. central heating boiler, open fire, wood burning stove, etc, a carbon monoxide detector is also required. The purchaser(s) should appraise themselves of the requirements of this legislation and engage with appropriate accredited contractors to ensure compliance.
Any additional limits to	For flats/maisonettes
inspection	Only the subject flat and internal communal areas giving access to the flat were inspected
	If the roof space or underbuilding/basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation
	The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance
	We have not carried out an inspection for Japanese Knotweed or other invasive plant species and unless otherwise stated for the purpose of this report we have assumes that there is no Japanese Knotweed or other invasive plant species within the boundaries of the proeprty or in neighbouring properties, the identification of Japanese Knotweed or other invasive plant species should be made by a Specialst Contractor.  We did not access the roof space. We were unable to inspect the front bedroom as this was occupied at the time of inspection. We did not inspect the interior of the coal store.
	As advised above floors were fully covered and carpeted at the time of inspection.

#### Sectional Diagram showing elements of a typical house

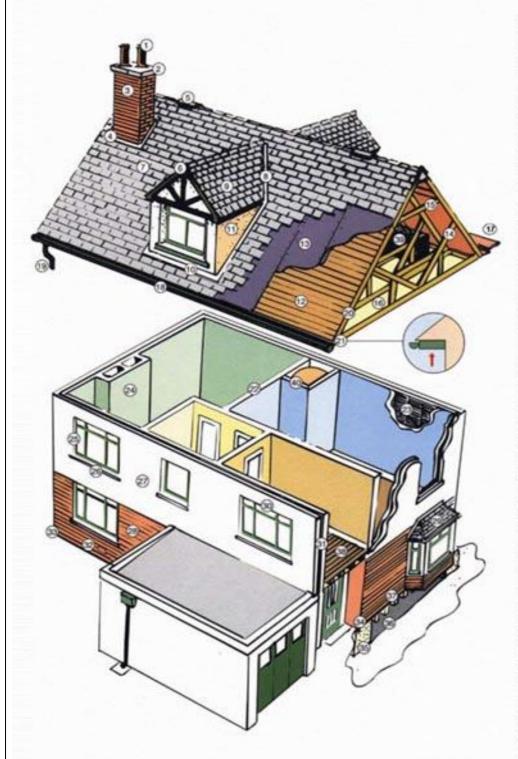

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3 Chimney head
- (4) Flashing
- (5) Ridge ventilation
- (6) Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- (10) Dormer flashing
- (11) Dormer cheeks
- (12) Sarking
- 13 Roof felt
- (14) Trusses
- (15) Collar
- (16) Insulation
- (17) Parapet gutter
- (18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards /skews
- (21) Soffit boards
- 22) Partition wall
- (23) Lath / plaster
- (24) Chimney breast
- (25) Window pointing
- (26) Window sills
- (27) Rendering
- 28) Brickwork / pointing
- (29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- (34) Base course
- 35) Foundations
- 36) Solum
- (37) Floor joists
- (38) Floorboards
- (39) Water tank
- (40) Hot water tank

#### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3		Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.		Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.
Structural movement	4		
Repair category	1		
Notes		ce of any significant cracking, current se the foundations are defective or inadeq	
Dampness, rot and infe	station		
Repair category	1		
Notes	No evidend	ce of any significant damp, rot or infesta	tion in any areas inspected.
Chimney stacks			
Repair category	3		
Notes	There is cr	acking and missing areas of render to the	he chimney stack.
Roofing including roof	space		
Repair category	1		
Notes	No evidence of any significant disrepair. There are a few cracked or chipped broken slates.		
Rainwater fittings			
Repair category	2		
Notes	A couple of joints to the gutters on the front are discoloured and appear to be leaking. Some basic ongoing maintenance is required in places.		
Main walls			
Repair category	1		
Notes	No evidence of any significant disrepair. The dry dash finish to the render on the rear elevation is beginning to thin.		
Windows, external door	Windows, external doors and joinery		
Repair category	1		
Notes	No evidence of any significant disrepair. Some window ironmongery is beginning to age and may require adjusting/oiling.		
External decorations	Ü	, , ,	
Repair category	2		
Notes	The decora	ations to the windows on the exposed re	ear elevation have weathered.
Conservatories/porches	<u> </u>		
Repair category	Not applica	able	
Notes			
L	I.		

2
The internal decorations to the stairwell are scuffed and marked in various places.  There is wear to the stairs and landings which is compatible with age. The intercom door system does not operate.
t outbuildings
None applicable
ndaries
2
Surfaces to the rear communal garden area require maintenance.
1
No evidence of any significant disrepair. The polystyrene tiles to the bathroom ceiling are perceived as being a safety hazard in the event of a fire.
1
No evidence of any significant disrepair. Plastered surfaces within the cupboards are worn.
pors
1
No evidence of any significant disrepair having regard to the limits of our inspection
then fittings
2
Internal joinery and kitchen fittings are displaying signs of wear and are considered dated. The plastic coating to the wall unit to the kitchen is beginning to delaminate.
replaces
No evidence of any significant disrepair. It is good practice to sweep chimney flues on a regular basis.
2
Some upgrading and modernisation of the internal decorations is considered desirable. The door to the front bedroom has been replaced but has not yet been decorated.
Not applicable
1
Modern fuse board. A routine test was carried out in 2018. The next test is due in 2023. There is a slight lack of power points typically to bedrooms for modern day standards. There is no carbon monoxide detector to the living room.

Gas	
Repair category	Not applicable
Notes	
Water, plumbing and ba	nthroom fittings
Repair category	1
Notes	Surfaces around the bath are a bit grubby. The end panel to the bath is loose. The seals to the shower end of the bath should be checked as this is susceptible to leaks.
Heating and hot water	
Repair category	2
Notes	The property would benefit from the installation of a more modern and efficient form of central heating.
Drainage	
Repair category	1
Notes	No evidence of any significant disrepair having regard to the limits of our inspection

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	3
Roofing including roof space	1
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	1
External decorations	2
Conservatories / porches	N/a
Communal areas	2
Garages and permanent outbuildings	N/a
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	N/a
Electricity	1
Gas	N/a
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

#### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

#### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

#### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. Accessibility information

#### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

Which floor(s) is the living accommodation on?	First floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes No X

#### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

It is assumed that the subjects are held on an absolute ownership basis [formerly feudal]. This should be confirmed by your solicitor.

In addition to the standard searches and enquiries to be carried out by your solicitor we would recommend that the following matters are confirmed:

- 1. The common elements of the property together with liabilities for the maintenance and upkeep of the same should be confirmed.
- 2. Is there a factor acting for the various co-owners in respect of the maintenance and upkeep of the property?

#### Estimated reinstatement cost for insurance purposes

It is recommended that the subjects be insured for a sum of not less than £150,000 [one hundred and fifty thousand pounds]

This figure is the estimate of the cost of rebuilding the property and bears no direct relationship to the current market value.

#### Valuation and market comments

£115,000 [one hundred & fifteen thousand pounds]

There is a strong demand for properties of this size and type within the town of Fort William.

Report author	John Strachan MRICS
Address	Samuel & Partners FS Scotland, First Floor, 20 High Street, Fort William, Scotland, PH33 6AT
Signed	Electronically prepared by Samuel & Partners
Date of report	11 November 2022

#### **Terms and Conditions**

#### **PART 1 - GENERAL**

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### 1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### 1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

12 Carn Dearg Road, Claggan, Fort William, PH33 6QB

Ref: 462/22/112 [Page 2 of 4]

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008:
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- + the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

#### PART 2 - DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

12 Carn Dearg Road, Claggan, Fort William, PH33 6QB Ref: 462/22/112

- <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems
  to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed
  now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

#### WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- \* There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

# Samuel & Partners Generic Valuation

		Mortga	age Valuati	ion Repo	ort		
Property:	12 Carn Dear	g Road	C	ustomer:			
. ,	Claggan		0	wner:			
	Fort William		In	troducer:			
	PH33 6QB		Te	enure:	Standard O	wnership (a	ssumed)
Date of Inspection:	09.11.22		R	eference:			
associated Home (The Red Book) a additional comme been prepared so that neither the wi	Report together wand the RICS Rules ents contained in Talely for mortgage thole nor any part of	with the inspection has of Conduct. Potent The Single Survey a lenders to consider	has been carried o tial purchasers mu nd also the Terms the property's sui eference thereto m	ut in accordan st not read this and Condition tability for mo	ce with the RICs is report in isolate is of the associa tgage finance. \	S Appraisal ai tion and your ated Home Re Your attention	above. This report and had Valuation Standards attention is drawn to the port. This report has is also drawn to the fact r statement without prior
1.0	LOCATION						
The property is amenities and t		stablished social re nearby	housing area w	ithin the tow	n of Fort Willia	am. All esse	ntial services,
2.0	DESCRIPTION	N		2.1 Age:	1957		
First floor flat				-			
3.0	CONSTRUCT	ION					
Cavity brickwor	k walls; pitched	and slated roof;	suspended con	crete floors			
4.0	ACCOMMODA	ATION					
Living room, kit	chen, bathroom	, 3 bedrooms					
5.0	SERVICES (N	o tests have bee	n applied to any	of the servi	ces)		
Water:	Mains	Electricity:	Mains	Gas:	None	Drains:	Mains
Central Heatin	g:	Full – solid fuel	to radiators				
6.0	OUTBUILDINGS						
Garage:	None						
Others:	None						
<b>GENERAL CONDITION</b> - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.							
The property is	in a satisfactor	y condition for ler	nding purposes.				

8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)									
None required as a condition of the mortgage										
8.1 Retention r	ecommen	ded:	Reflected in	the va	aluation					
9.0	ROADS	& FOOTPATHS								
		iths adjacent to the pr y the Local Authority?		[ X ]	YES[]	NO	If No, o		ent t	to be made in
10.0	BUILDIN	IGS INSURANCE	£150,000			SS EXTERNA OR AREA	AL	93		Sq m
	destruction fittings have	is an opinion of an appropria on a re-instatement basis a e not been included. No allo ce has been made for VAT,	assuming reconsti wance has been	ruction of included	of the prop I for inflat	perty in its existing ion during the ins	ng design s <i>urance pe</i>	and ma	terials during	s. Furnishings and g re-construction and
11.0	GENERA	L REMARKS	,							
The common eleconfirmed.	ements of	the property and any i	responsibility	for the	mainte	enance and u	pkeep o	f the s	ame	should be
12.0	onerous be been requi made as w asbestos i inspection	<b>TION</b> On the assumption of urdens, title restrictions or sized, have been sought and we consider such matters to none or more of its composite test for asbestos and fut o undertake appropriate te	servitude rights. I d obtained. No in o be outwith the s onents or fittings. ture occupants si	t is assu estigat cope of It is imp	imed that ion of any this repo oossible t	t all necessary L contamination ort. All property b o identify withou	ocal Autho on, under ouilt prior to It a test. It	ority cor or within the yea is beyor	nsent in the ar 20 nd the	s, which may have property has been 00 may contain e scope of this
12.1	Market \	/alue in present n	£115,000			One hundred	d & fiftee	n thou	usan	d pounds
12.2	Market \ complet works:	/alue on ion of essential	£			See remarks	s in Sect	ion 11	of t	his report.
12.3	12.3 Suitable security for normal mortgage purposes? [X]YES[]NO									
Signature Electronically signed = John Strachan										
Surveyor:	John Strachan, MRICS  Date: 11 November 202					November 2022				
Surveyor Com	pany:	Samuel & Partners,	First Surveyo	rs Sco	tland					
Address:	ddress: First Floor, 20 High Street Fort William, PH33 6AT									
Telephone:		01397 702686								
E-mail		info@samuelandpart	tners.co.uk				L			

#### **Energy Performance Certificate (EPC)**

**Dwellings** 

### **Scotland**

#### 12 CARN DEARG ROAD, CLAGGAN, FORT WILLIAM, PH33 6QB

Dwelling type: Mid-floor flat

Date of assessment: 09 November 2022

Date of certificate: 14 November 2022

Total floor area: 83 m<sup>2</sup>

Primary Energy Indicator: 263 kWh/m²/year

**Reference number:** 9812-4429-0209-0381-1202 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

**Main heating and fuel:** Boiler and radiators, dual fuel


(mineral and wood)

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,441	See your recommendations
Over 3 years you could save*	£1,011	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

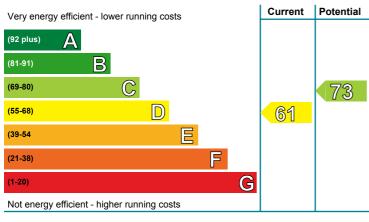


#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

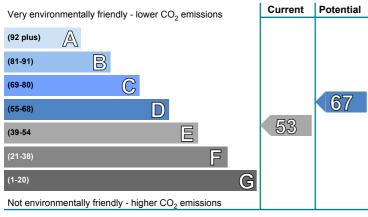

#### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (53)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

#### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£810.00
2 Heating controls (programmer, thermostat, TRVs)	£350 - £450	£201.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed) Cavity wall, as built, partial insulation (assumed)	***** ***	***** ***
Roof	(another dwelling above)	<u>—</u>	_
Floor	(another dwelling below)	<u>—</u>	_
Windows	Fully double glazed	***	***
Main heating	Boiler and radiators, dual fuel (mineral and wood)	***	***
Main heating controls	No time or thermostatic control of room temperature	****	****
Secondary heating	None	_	_
Hot water	From main system	***	***
Lighting	Low energy lighting in all fixed outlets	****	****

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

#### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 56 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,313 over 3 years	£1,302 over 3 years	
Hot water	£894 over 3 years	£894 over 3 years	You could
Lighting	£234 over 3 years	£234 over 3 years	save £1,011
Totals	£3,441	£2,430	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December and management	lu diantius annt	Typical saving	Rating after improvement		
Recommended measures	Indicative cost	per year	Energy	Environment	
1 Cavity wall insulation	£500 - £1,500	£270	C 70	D 64	
2 Upgrade heating controls	£350 - £450	£67	C 73	D 67	

#### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

External insulation with cavity wall insulation

#### Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

#### 2 Heating controls (programmer, room thermostat and thermostatic radiator valves)

The heating system would benefit from a programmer and room thermostat to allow you to set the temperature and programme when you want the heating and hot water to switch on and off; this will reduce the amount of energy used and lower fuel bills. Thermostatic radiator valves should also be installed, to allow the temperature of each room to be controlled to suit individual needs, adding to comfort and reducing heating bills. For example, they can be set to be warmer in the living room and bathroom than in the bedrooms. Ask a competent heating engineer to install radiator valves and a fully pumped system with the pump and the boiler turned off by the room thermostat. Radiator valves should be fitted to every radiator except one – the radiator in the same room as the room thermostat. Remember the room thermostat is needed to enable the boiler to switch off when no heat is required, thermostatic radiator valves on their own do not turn the boiler off. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	7,908	N/A	(2,885)	N/A
Water heating (kWh per year)	2,508			

#### **Addendum**

#### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. John Strachan

Assessor membership number: EES/009418

Company name/trading name: Samuel and Partners Address: 20 High Street

20 High Street Fort William

Phone number: PH33 6AT 01397 702686

Email address: john@samuelandpartners.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT

