

**Rockvale
Lundavra Road
Fort William
PH33 6RF**



Inspected on: 15th April 2026

Prepared by:
Samuel & Partners
First Surveyors Scotland
First Floor
20 High Street
FORT WILLIAM
PH33 6AT

H o m e R e p o r t - i n d e x

1. Property Questionnaire
2. Single Survey
3. Mortgage Valuation
4. Energy Report

Property Questionnaire

PROPERTY ADDRESS:	Rockvale Lundavra Road Fort William PH33 6RF
-------------------	---

SELLER(S):	Mary Coat Nicola MacLeod
------------	-------------------------------------

COMPLETION DATE OF PROPERTY QUESTIONNAIRE:	12.04.26
--	-----------------

PROPERTY QUESTIONNAIRE

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? Almost 4 years	
2.	Council Tax	
	Which Council Tax band is your property in? N/A (Non Domestic Rates)	
	A B C D E F G H	
3.	Parking	
	What are the arrangements for parking at your property? (Please indicate all that apply) <ul style="list-style-type: none"> • Garage • Allocated parking space • Driveway • Shared parking • On street • Resident permit • Metered parking • Other (please specify): We use the hotel car park, adjacent to the house 	
4.	Conservation Area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No
5.	Listed Buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations / additions / extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
	<u>If you have answered yes</u> , please describe the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	

	<p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.</p>	
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	No
	(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	<p>(iii) Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	
7.	Central heating	
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes/partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air.)</p>	Yes
	<u>If you have answered yes, please answer the 3 questions below:</u>	
b.	When was your central heating system or partial central heating system installed?	?
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance agreement:</p>	No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes
9.	Issues that may have affected your property	
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	No

b. Are you aware of the existence of asbestos in your property? <u>If you have answered yes, please give details:</u>	No																								
10. Services																									
a. Please tick which services are connected to your property and give details of the supplier:																									
<table border="1"> <thead> <tr> <th data-bbox="245 338 644 383">Services</th> <th data-bbox="644 338 911 383">Connected</th> <th data-bbox="911 338 1305 383">Supplier</th> </tr> </thead> <tbody> <tr> <td data-bbox="245 383 644 488">Gas / liquid petroleum gas</td> <td data-bbox="644 383 911 488"></td> <td data-bbox="911 383 1305 488"></td> </tr> <tr> <td data-bbox="245 488 644 600">Water mains / private water supply</td> <td data-bbox="644 488 911 600" style="text-align: center;">✓</td> <td data-bbox="911 488 1305 600">Scottish Water</td> </tr> <tr> <td data-bbox="245 600 644 712">Electricity</td> <td data-bbox="644 600 911 712" style="text-align: center;">✓</td> <td data-bbox="911 600 1305 712">Octopus</td> </tr> <tr> <td data-bbox="245 712 644 824">Mains drainage</td> <td data-bbox="644 712 911 824" style="text-align: center;">✓</td> <td data-bbox="911 712 1305 824">?</td> </tr> <tr> <td data-bbox="245 824 644 936">Telephone</td> <td data-bbox="644 824 911 936" style="text-align: center;">✓</td> <td data-bbox="911 824 1305 936">Talk Talk</td> </tr> <tr> <td data-bbox="245 936 644 1048">Cable TV / satellite</td> <td data-bbox="644 936 911 1048" style="text-align: center;">✓</td> <td data-bbox="911 936 1305 1048">Talk Talk</td> </tr> <tr> <td data-bbox="245 1048 644 1122">Broadband</td> <td data-bbox="644 1048 911 1122" style="text-align: center;">✓</td> <td data-bbox="911 1048 1305 1122">Talk Talk</td> </tr> </tbody> </table>	Services	Connected	Supplier	Gas / liquid petroleum gas			Water mains / private water supply	✓	Scottish Water	Electricity	✓	Octopus	Mains drainage	✓	?	Telephone	✓	Talk Talk	Cable TV / satellite	✓	Talk Talk	Broadband	✓	Talk Talk	
Services	Connected	Supplier																							
Gas / liquid petroleum gas																									
Water mains / private water supply	✓	Scottish Water																							
Electricity	✓	Octopus																							
Mains drainage	✓	?																							
Telephone	✓	Talk Talk																							
Cable TV / satellite	✓	Talk Talk																							
Broadband	✓	Talk Talk																							
b. Is there a septic tank system at your property? <u>If you have answered yes, please answer the two questions below:</u>	No																								
c. Do you have appropriate consents for the discharge from your septic tank?																									
d. Do you have a maintenance contract for your septic tank? <u>If you have answered yes, please give details of the company with which you have a maintenance contract:</u>																									
11. Responsibilities for Shared or Common Areas																									
a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes, please give details:</u>	No																								
b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? <u>If you have answered yes, please give details:</u>	No																								
c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No																								

d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? <u>If you have answered yes, please give details:</u>	No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? <u>If you have answered yes, please give details:</u>	No
f.	As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) <u>If you have answered yes, please give details:</u>	No
12. Charges associated with your property		
a.	Is there a factor or property manager for your property? <u>If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:</u>	No
b.	Is there a common buildings insurance policy? <u>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</u>	
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.	
13. Specialist Works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property</u>	No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? <u>If you have answered yes, please give details</u>	No

c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>					
14. Guarantees						
a.	Are there any guarantees or warranties for any of the following:					
(i)	Electrical work	No	Yes	No	With title deeds	Lost
(ii)	Roofing	No	Yes	No	With title deeds	Lost
(iii)	Central heating	No	Yes	No	With title deeds	Lost
(iv)	NHBC	No	Yes	No	With title deeds	Lost
(v)	Damp course	No	Yes	No	With title deeds	Lost
(vi)	Any other work or installations? (e.g: cavity wall insulation, underpinning, indemnity policy)	No	Yes	No	With title deeds	Lost
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
c.	<p>Are there any outstanding claims under any of the guarantees listed above?</p> <p>If you have answered yes, please give details:</p>	No				
15. Boundaries						
<p>So far as you are aware, has any boundary of your property been moved in the last 10 years?</p> <p>If you have answered yes, please give details:</p>		Don't know				
16. Notices that affect your property						
In the past 3 years have you ever received a notice:						
a.	advising that the owner of a neighbouring property has made a planning application?	Yes				
b.	that affects your property in some other way?	No				
c.	that requires you to do any maintenance, repairs or improvements to your property?	No				

<p>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.</p>	
--	--

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :

.....**M Coat**.....

.....**N MacLeod**.....

Date:**12.04.26**.....

single survey

survey report on:

Property address	Rockvale Lundavra Road Fort William PH33 6RF
-------------------------	---

Customer	Nicola MacLeod
-----------------	----------------

Customer address	
-------------------------	--

Prepared by	John Strachan MRICS Samuel & Partners - FS Scotland
--------------------	---

Date of Inspection	15 th April 2025
---------------------------	-----------------------------

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without the need to move any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right are taken facing the front of the property.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc were not inspected or reported on.

Description	A detached dwelling house.
Accommodation	Ground floor: porch, living room, kitchen and dining, rear porch and a shower room. Externally accessed store and boiler room. First floor: landing, 2 bedrooms (1 with walk in wardrobe) and a bathroom.
Gross internal floor area (m ²)	111 sq m.
Neighbourhood and location	The property is set in the town of Fort William in an area of mixed private and commercial properties. All essential services, amenities and transport links are nearby.
Age	Originally built around 1900, extended in the 1980s.
Weather	Overcast with light outbreaks of rain. The preceding weather was similar.
Chimney stacks	<i>Visually inspected with the aid of binoculars where appropriate</i> There is a masonry constructed chimney stack to the rear with rendered surfaces, concrete cope and a clay pot. The junction with the main roof is weathered in lead.
Roofing including roof space	<i>Sloping roofs were visually inspected with the aid of binoculars where appropriate</i> <i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3 m ladder externally</i> <i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3 m ladder within the property</i> <i>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so</i> The roof is pitched and covered in a natural slate. There are European slates on the front roof and reclaimed West Highland slates on the rear roof slopes. The ridge is in a zinc capping. There is a Velux rooflight to the rear. The roof space is accessed via a ceiling hatch to the landing. The roof is of traditional joiner made construction with a softwood sarking board. The lean-to roof to the rear can be accessed from a hatch to the boiler room. The roofs are of joiner made construction with a softwood sarking board. There is glass wool insulation between the ceiling joists.
Rainwater fittings	<i>Visually inspected with the aid of binoculars where appropriate</i> Upvc gutters and downpipes.
Main walls	<i>Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected</i> The external walls to the original portion of the property are in solid stone construction. The walls are finished externally in a traditional render. The walls to the rear extension appear to be in cavity brickwork construction and are rendered to match. Internal surfaces are a mix of lath and plaster and later plasterboard. The extension walls are in a plaster on the hard.


single survey

Windows, external doors and joinery	<p><i>Internal and external doors were opened and closed where keys were available</i></p> <p><i>Random windows were opened and closed where possible. Doors and windows were not forced open</i></p> <p>Windows are mainly in replacement upvc with sealed double glazed panels. There are two timber frame double glazed windows on the right hand gable elevation. The external doors are in upvc. The doors to the boiler room and store are in timber.</p> <p>Fascias and barge boards are in timber. The outriggers are exposed along the soffits.</p>
External decorations	<p><i>Visually inspected</i></p> <p>The fascias, soffits and outriggers are stained. The timber windows are stained. The rendered walls have a masonry paint finish.</p>
Conservatories/porches	<p><i>Visually inspected</i></p> <p>There are porches to the front and rear. These appear to be in timber frame construction with an outer leaf in rendered brick or concrete block. The front porch roof is pitched and covered in a European slate. The roof to the rear porch is of a shallow profile covered in artificial slate. The floors are in concrete.</p>
Communal areas	<p><i>Circulation areas visually inspected</i></p> <p>Access to the property is over a shared road.</p>
Garages and permanent outbuildings	<p><i>Visually inspected</i></p> <p>None.</p>
Outside areas and boundaries	<p><i>Visually inspected</i></p> <p>There are gardens mainly to the front which are sloping and covered in grass. There are stone chipped footpaths and concrete slabbed footpaths. There is an area of ground to the side. The oil storage tank is contained within a brickwork enclosure. Boundaries where defined are in masonry construction.</p>
Ceilings	<p><i>Visually inspected from floor level</i></p> <p>Lath and plaster or plasterboard. The ceiling to the kitchen and dining is of a barrel vaulted style with timber cladding.</p>
Internal walls	<p><i>Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate</i></p> <p>Timber frame with lath and plaster or plasterboard.</p>
Floors including sub floors	<p><i>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted</i></p> <p><i>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point</i></p> <p><i>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1 m between the underside of floor joists and the solum as determined from the access hatch</i></p> <p>Floors appear to be in a mix of concrete, floating and suspended timber. Floors were fully covered and carpeted at the time of inspection. There is no access to the sub floor space.</p>
Internal joinery and kitchen fittings	<p><i>Built in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances</i></p> <p>Facings and skirtings are in timber. Internal doors are mainly in four panel. The stair is original in timber construction in one flight with winders. There are original newel posts and handrails.</p> <p>Kitchen fittings comprise of three base units with a proprietary worktop and inset stainless steel sink. The doors have a vinyl finish. There is a space for the free standing cooker.</p>
Chimney breasts and fireplaces	<p><i>Visually inspected. No testing of the flues or fittings were carried out</i></p> <p>None</p>
Internal decorations	<p><i>Visually inspected</i></p> <p>Ceilings and walls are in an emulsion paint finish on a plain plasterboard backing. Internal joinery is painted or stained.</p>
Cellars	<p><i>Visually inspected where there was a safe and purpose built access</i></p> <p>None</p>

single survey

<p>Electricity</p>	<p><i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on</i></p> <p>Mains electricity supply. The meter and fuse board are located at high level within a cupboard to the living room. Electrical fittings are a mix of age.</p>
<p>Gas</p>	<p><i>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on</i></p> <p>None</p>
<p>Water, plumbing, bathroom fittings</p>	<p><i>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation, No tests whatsoever were carried out to the system or appliances</i></p> <p>Mains water supply. Plumbing supplies where viewed are in copper or alkathene, wastes are in plastic.</p> <p>Bathroom fittings comprise of ceramic wcs, ceramic wash hand basins, an acrylic bath and a proprietary shower enclosure. Showers are provided by thermostatic mixer valves. Surfaces around the bath and shower are in a proprietary wet wall or tiled.</p>
<p>Heating and hot water</p>	<p><i>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected</i></p> <p><i>No tests whatsoever were carried out to the system or appliances</i></p> <p>Central heating is from an oil fired boiler. There is a plastic oil storage tank to the side. The boiler heats steel radiators throughout the property.</p> <p>Hot water is heated and stored in a direct feed stainless steel cylinder located in the roof space above the boiler.</p>
<p>Drainage</p>	<p><i>Drainage covers etc were not lifted</i></p> <p><i>Neither drains nor drainage systems were tested</i></p> <p>Drainage connects to the mains system.</p>
<p>Fire, smoke and burglar alarms</p>	<p><i>Visually inspected. No tests whatsoever were carried out to the system or appliances</i></p> <p>There are no fire or burglar alarms. There are smoke detectors in places.</p> <p>Fire Safety Legislation effective from February 2022 requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat detection alarm must be installed in every kitchen area and all smoke and heat alarms must be ceiling mounted and interlinked. Where there is a carbon fuelled appliance e.g. central heating boiler, open fire, wood burning stove, etc, a carbon monoxide detector is also required. The purchaser(s) should appraise themselves of the requirements of this legislation and engage with appropriate accredited contractors to ensure compliance.</p>
<p>Any additional limits to inspection</p>	<p><i>For flats/maisonettes. Only the subject flat and internal communal areas giving access to the flat were inspected</i></p> <p><i>If the roof space or underbuilding/basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation</i></p> <p><i>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance</i></p> <p><i>We have not carried out an inspection for Japanese Knotweed or other invasive plant species and unless otherwise stated for the purpose of this report we have assumed that there is no Japanese Knotweed or other invasive plant species within the boundaries of the property or in neighbouring properties. the identification of Japanese Knotweed or other invasive plant species should be made by a Specialist Contractor.</i></p> <p>As mentioned above, floors were fully covered and carpeted at the time of inspection.</p> <p>We did not enter the roof spaces.</p> <p>A ground floor cupboard was locked at the time of inspection.</p>

Sectional Diagram showing elements of a typical house

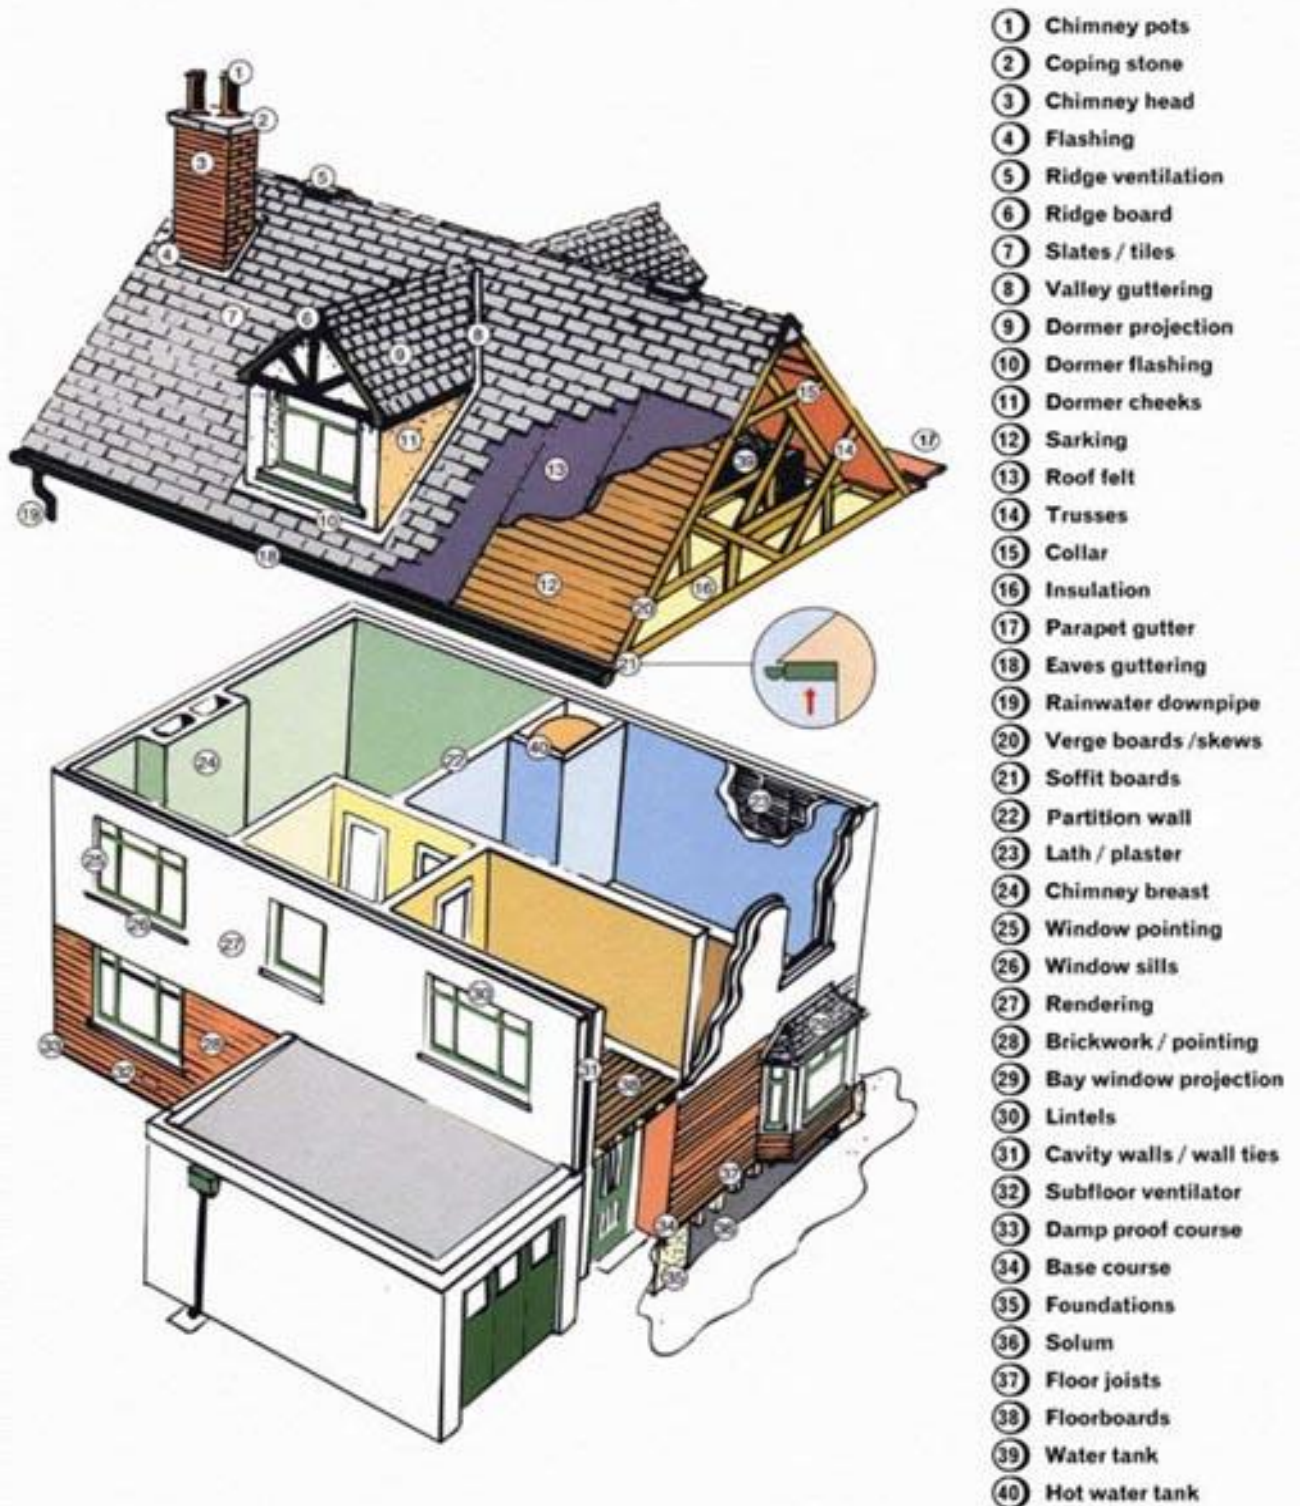

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3		Category 2		Category 1	
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.		Repairs or replacement requiring future attention, but estimates are still advised.		No immediate action or repair is needed.	
Structural movement					
Repair category		1			
Notes		No evidence of any significant cracking, current settlement and no conditions present to suggest the foundations are defective or inadequate.			
Dampness, rot and infestation					
Repair category		3			
Notes		<p>There is damp to the base of the wall within the right hand side of the rear extension. This appears to be caused by surface water entering the side stores. There is evidence of a localised area of wood boring insect infestation to the roof void timbers to the main roof space.</p> <p>The property should be inspected by a firm of suitably experienced contractors.</p>			
Chimney stacks					
Repair category		2			
Notes		Although the chimney stack is redundant there is cracking and boss render to the right hand face.			
Roofing including roof space					
Repair category		2			
Notes		<p>There are a couple of individual slates that require attention on the rear elevation. There is water staining to the underside of the sarking boards in places.</p> <p>As mentioned above there appears to be traces of wood boring insect infestation to the roof void timbers.</p> <p>The ceiling above the store and boiler room is in a fibre cement board. This age and type of board may contain asbestos.</p>			
Rainwater fittings					
Repair category		1			
Notes		No evidence of any significant disrepair. The downpipe to the rear porch discharges over the ground. This should connect into an underground drain.			
Main walls					
Repair category		2			
Notes		<p>There is hairline cracking to the render typically around window openings. We recorded boss (debonded) render in a few isolated areas.</p> <p>As mentioned above there is damp to the base of the right hand wall in the rear extension. The ground levels around the side and rear of the property are high relative to internal floor levels.</p>			
Windows, external doors and joinery					
Repair category		2			
Notes		Some of the windows are stiff to open. There is rot to the doors and frame to the external stores.			

single survey

	The condition of the barge board on the left hand gable should be checked at high level. It appears there is a small area of rot to the bead below the slates along the verge.
External decorations	
Repair category	1
Notes	No evidence of any significant weathering. Knots are showing to the barge board on the front elevation. The paint to the render finish is beginning to wear slightly in places.
Conservatories/porches	
Repair category	2
Notes	The render to the rear porch is damaged at the external corner. The roof pitch to the rear porch is shallow. These slates should be laid at a steeper slope.
Communal areas	
Repair category	1
Notes	No evidence of any significant disrepair.
Garages and permanent outbuildings	
Repair category	Not applicable
Notes	
Outside areas and boundaries	
Repair category	2
Notes	There is wear to the render to the garden walls. Surface water discharges to the side and requires to be channelled into a suitable underground drain.
Ceilings	
Repair category	1
Notes	No evidence of any significant disrepair. There is some minor hairline cracking to the plaster finish in places.
Internal walls	
Repair category	1
Notes	No evidence of any significant disrepair.
Floors including sub-floors	
Repair category	2
Notes	The ground floor at the dining and kitchen gives in places when walked upon. As mentioned above there is damp to the base of the wall in the rear extension. We recorded high damp meter readings at the door threshold to the kitchen and rear porch. We recommend that the condition of the floors are checked. There is a fall to the floor to the first floor right hand bedroom. It would be wise to check the condition of the floor in this room.
Internal joinery and kitchen fittings	
Repair category	1
Notes	No evidence of any significant disrepair. The edges of a couple of timber window cills to the front appear to have been affected by damp. At the time of inspection surfaces were dry.
Chimney breasts and fireplaces	
Repair category	Not applicable
Notes	

single survey

Internal decorations	
Repair category	1
Notes	No evidence of any significant wear.
Cellars	
Repair category	Not applicable
Notes	
Electricity	
Repair category	1
Notes	There is a note on the fuse board confirming that an electrical test was last carried out in October 2023. We therefore assume the electrical installation is in an acceptable condition.
Gas	
Repair category	Not applicable
Notes	
Water, plumbing and bathroom fittings	
Repair category	1
Notes	No evidence of any significant disrepair.
Heating and hot water	
Repair category	2
Notes	It is good practice to service oil boilers on a regular basis. The flue outlet to the boiler is loose and a protective basket is required. We note the flue outlet is close to a plastic soil vent pipe.
Drainage	
Repair category	2
Notes	There was some surface water lying adjacent to the side store doors.

single survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	2
Communal areas	1
Garages and permanent outbuildings	N/a
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	2
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	N/a
Internal decorations	1
Cellars	N/a
Electricity	1
Gas	N/a
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	2

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is assumed that the subjects are held on an absolute ownership basis [formerly feudal]. This should be confirmed by your solicitor.

In addition to the standard searches and enquiries to be carried out by your solicitor we would recommend that the following matters are confirmed:

1. Details concerning the access arrangements and any liabilities for the maintenance and upkeep of the same should be provided.

Estimated reinstatement cost for insurance purposes

It is recommended that the subjects be insured for a sum of not less than £450,000 [four hundred & fifty thousand pounds]

This figure is the estimate of the cost of rebuilding the property and bears no direct relationship to the current market value.

Valuation and market comments

£240,000 [two hundred & forty thousand pounds].

There is a steady demand for properties of this size and type within the town of Fort William.

Report author	John Strachan MRICS
Address	Samuel & Partners FS Scotland, First Floor, 20 High Street, Fort William, Scotland, PH33 6AT
Signed	Electronically prepared by Samuel & Partners
Date of report	23 April 2026

Terms and Conditions

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report is transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

¹ Which shall be in accordance with the current RIGS Valuation Standards (The Red Book) and RIGS Rules of Conduct.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.5 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.6 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.7 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.8 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
 - the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
 - the "Seller" is/are the proprietor(s) of the Property;
 - the "Surveyor" is the author of the Report on the Property; and
 - the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- + the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- * There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

Samuel & Partners Generic Valuation

Mortgage Valuation Report

Property:	Rockvale Lundavra Road Fort William PH33 6RF	Customer:	
		Owner:	
		Introducer:	
		Tenure:	Standard Ownership (assumed)
Date of Inspection:	15.04.26	Reference:	

This Mortgage Valuation Report has been issued as part of The Home Report prepared on the property referred to above. This report and associated Home Report together with the inspection has been carried out in accordance with the RICS Appraisal and Valuation Standards (The Red Book) and the RICS Rules of Conduct. Potential purchasers must not read this report in isolation and your attention is drawn to the additional comments contained in The Single Survey and also the Terms and Conditions of the associated Home Report. This report has been prepared solely for mortgage lenders to consider the property's suitability for mortgage finance. Your attention is also drawn to the fact that neither the whole nor any part of the report or any reference thereto may be included in any document, circular or statement without prior approval in writing as to the form in which it will appear.

1.0	LOCATION
------------	-----------------

The property is set in the town of Fort William in an area of mixed private and commercial properties. All essential services, amenities and transport links are nearby.

2.0	DESCRIPTION	2.1 Age:	1900	
------------	--------------------	-----------------	------	--

A detached dwelling house. Extended in the 1980s.

3.0	CONSTRUCTION
------------	---------------------

Solid stone and cavity brickwork walls; pitched and slated roof; concrete and timber floors.

4.0	ACCOMMODATION
------------	----------------------

Ground floor: porch, living room, kitchen and dining, rear porch and a shower room.
First floor: landing, 2 bedrooms (1 with walk in wardrobe) and a bathroom.

5.0	SERVICES (No tests have been applied to any of the services)					
------------	---	--	--	--	--	--

Water:	Mains	Electricity:	Mains	Gas:	None	Drains:	Mains
Central Heating:	Full – oil boiler to radiators						

6.0	OUTBUILDINGS
------------	---------------------

Garage:	None
----------------	------

Others:	None
----------------	------

7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>
------------	--

The property is in a satisfactory condition for lending purposes.

8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)			
None required as a condition of the mortgage				
8.1 Retention recommended:			Reflected in the valuation.	
9.0	ROADS & FOOTPATHS			
Have the roads and footpaths adjacent to the property been adopted and maintained by the Local Authority?			[X]YES []NO	<i>If No, comment to be made in Section 11</i>
10.0	BUILDINGS INSURANCE	£450,000	GROSS EXTERNAL FLOOR AREA	128 Sq m
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>				
11.0	GENERAL REMARKS			
12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>			
12.1	Market Value in present condition	£240,000	Two hundred & forty thousand pounds	
12.2	Market Value on completion of essential works:	£	<i>See remarks in Section 11 of this report.</i>	
12.3	Suitable security for normal mortgage purposes?	[X]YES []NO		
Signature	Electronically signed = John Strachan			
Surveyor:	John Strachan, MRICS		Date:	23 April 2026
Surveyor Company:	Samuel & Partners, First Surveyors Scotland			
Address:	First Floor, 20 High Street Fort William, PH33 6AT			
Telephone:	01397 702686			
E-mail	info@samuelandpartners.co.uk			

Energy Performance Certificate (EPC)

Scotland

Dwellings

ROCKVALE COTTAGE, LUNDAVRA ROAD, FORT WILLIAM, PH33 6RF

Dwelling type: Detached house
Date of assessment: 25 August 2023
Date of certificate: 28 August 2023
Total floor area: 111 m²
Primary Energy Indicator: 247 kWh/m²/year


Reference number: 2154-1026-5208-1857-1204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, oil

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,757	See your recommendations report for more information
Over 3 years you could save*	£2,571	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

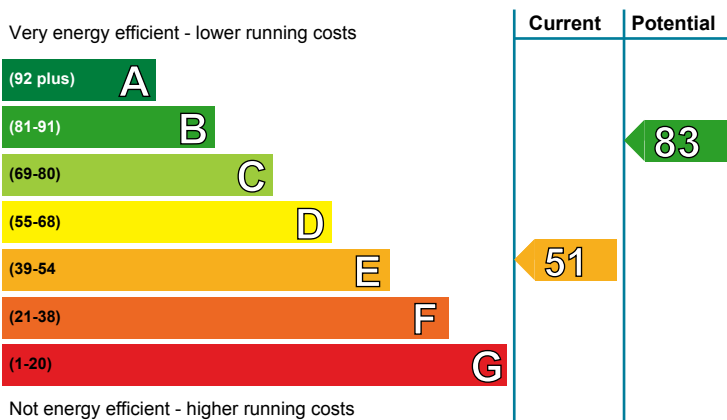


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (51)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

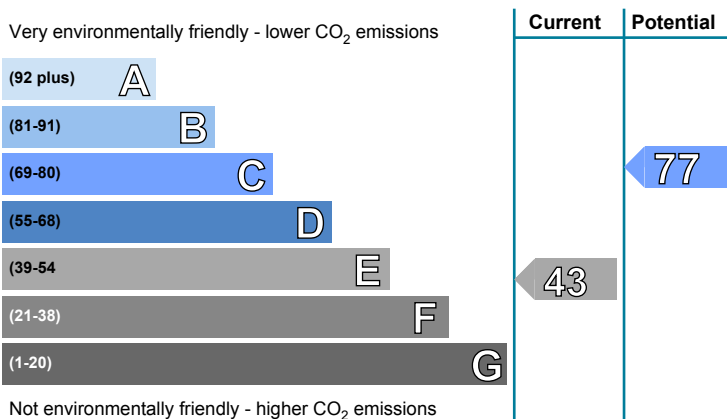

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (43)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£108.00
2 Internal wall insulation	£4,000 - £14,000	£1446.00
3 Floor insulation (solid floor)	£4,000 - £6,000	£222.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whinstone, as built, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
Floor	Solid, no insulation (assumed)	—	—
	Suspended, limited insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, oil	★★★☆☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system, no cylinder thermostat	★★☆☆☆	★★☆☆☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 65 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 7.2 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.











Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,879 over 3 years	£2,238 over 3 years	
Hot water	£1,395 over 3 years	£465 over 3 years	
Lighting	£483 over 3 years	£483 over 3 years	
Totals	£5,757	£3,186	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Increase loft insulation to 270 mm	£100 - £350	£36		
2 Internal wall insulation	£4,000 - £14,000	£482		
3 Floor insulation (solid floor)	£4,000 - £6,000	£74		
4 Solar water heating	£4,000 - £6,000	£265		
5 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£557		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	14,737	(443)	N/A	(5,922)
Water heating (kWh per year)	5,302			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. John Strachan
Assessor membership number:	EES/009418
Company name/trading name:	Samuel and Partners
Address:	20 High Street Fort William PH33 6AT
Phone number:	01397 702686
Email address:	john@samuelandpartners.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT

